

<b>Applicant:</b> Universidad Central Del Caribe, Inc.	<b>Damage Inventory:</b> 305240	<b>Category:</b> E
<b>WO #</b> 46525 <b>FIPS#</b> 021-UNUGB-00	<b>Date:</b> 09/04-17/2019 <b>GPS:</b> 18.365953, -66.153767	
<b>Inspector:</b> Gregory Sondergeld / Alexander Nieves	<b>Damage Facility:</b> Main Bldg.	

<b>Damage Description:</b>	<b>Item #:</b> 1
Ceiling, ¼ IN thick plaster on concrete, repair spalling and paint, cracked, caused by rain water intrusion (Main Bldg., Exterior, Main Entrance)	
<b>Additional Comments:</b>	

<b>Damage Description:</b>	<b>Item #:</b> 2
Wall, ¼ IN thick plaster on concrete, repair spalling and paint, discolored, caused by rainwater intrusion (Main Bldg., Exterior, Fascia East & West)	
<b>Additional Comments:</b>	



<b>Damage Description:</b>	<b>Item #:</b> 3
Entrance Canopy, steel-framed, barrel vault-shaped, fabric covering only, broken components, caused by high winds (Main Bldg., Exterior, Canopy)	
<b>Additional Comments:</b>	


<b>Damage Description:</b>	<b>Item #:</b> 4
Light, Outdoor, surface-mounted, soffit fixture, 1 FT x 1 FT, clear acrylic lens cover only, cracked, caused by high winds (Main Bldg., Exterior, Entire Floor)	
<b>Additional Comments:</b>	



<b>Applicant:</b> Universidad Central Del Caribe, Inc.	<b>Damage Inventory:</b> 305240	<b>Category:</b> E
<b>WO #</b> 46525 <b>FIPS#</b> 021-UNUGB-00	<b>Date:</b> 09/04-17/2019 <b>GPS:</b> 18.365953, -66.153767	
<b>Inspector:</b> Gregory Sondergeld / Alexander Nieves	<b>Damage Facility:</b> Main Bldg.	

<b>Damage Description:</b>	<b>Item #:</b> 5
Light, Wall Pack luminaire, 110 Volt, 200-Watt, high-pressure sodium, cracked, caused by wind-blown debris (Main Bldg., Exterior, Entire Floor)	
<b>Additional Comments:</b>	

<b>Damage Description:</b>	<b>Item #:</b> 6
Wall, ¼ IN thick plaster on concrete, repair spalling, discolored, caused by rainwater intrusion (Main Bldg., Exterior, Entire Floor)	
<b>Additional Comments:</b>	

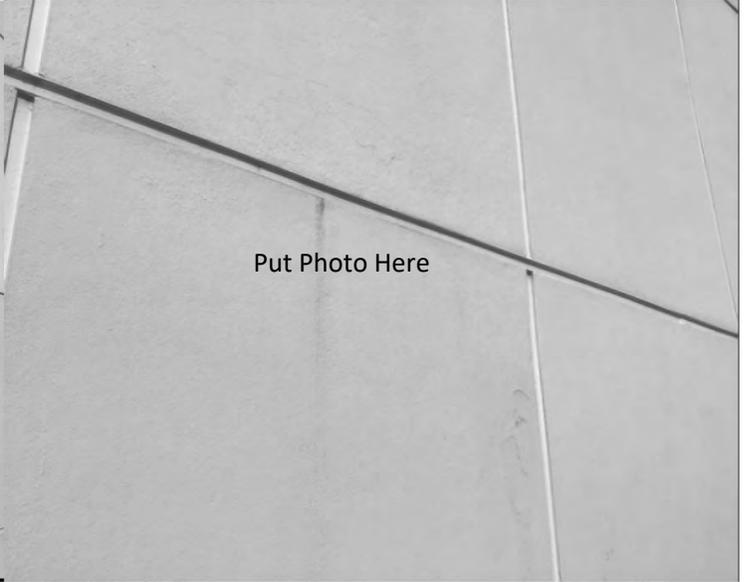

<b>Damage Description:</b>	<b>Item #:</b> 7
Wall, ¼ IN thick plaster on concrete, painted, discolored, caused by rainwater intrusion (Main Bldg., Exterior, Entire Floor)	
<b>Additional Comments:</b>	

<b>Damage Description:</b>	<b>Item #:</b> 8
Tubular steel security gate, wooden insert only, 1 IN D x 8 IN W x 8 FT L, painted, broken components, caused by wind-blown debris (Main Bldg., Exterior, Steel Security Gate)	
<b>Additional Comments:</b>	



<b>Applicant:</b> Universidad Central Del Caribe, Inc.	<b>Damage Inventory:</b> 305240	<b>Category:</b> E
<b>WO #</b> 46525 <b>FIPS#</b> 021-UNUGB-00	<b>Date:</b> 09/04-17/2019	<b>GPS:</b> 18.365953, -66.153767
<b>Inspector:</b> Gregory Sondergeld / Alexander Nieves	<b>Damage Facility:</b> Main Bldg.	

<b>Damage Description:</b>	<b>Item #:</b> 9	<b>Damage Description:</b>	<b>Item #:</b> 10 Wall,
Wall, ¼ IN thick plaster on concrete, repair spalling, peeling paint, caused by rainwater intrusion (Main Bldg., Exterior, Entire Floor)		¼ IN thick plaster on concrete, painted, peeling paint, caused by rainwater intrusion (Main Bldg., Exterior, Entire Floor)	
<b>Additional Comments:</b>		<b>Additional Comments:</b>	



<b>Damage Description:</b>	<b>Item #:</b> 11	<b>Damage Description:</b>	<b>Item #:</b> 12
Ceiling, 2 FT x 2 FT acoustic tile, suspended, tegular, discolored, caused by rainwater intrusion (Main Bldg., Floor 1, Cafeteria)		Roof, Metal flashing, 26 gauge, 6 IN x 6 IN, deformed, caused by high winds (Main Bldg., Floor 1, Cafeteria)	
<b>Additional Comments:</b>		<b>Additional Comments:</b>	



<b>Applicant:</b> Universidad Central Del Caribe, Inc.	<b>Damage Inventory:</b> 305240	<b>Category:</b> E
<b>WO #</b> 46525 <b>FIPS#</b> 021-UNUGB-00	<b>Date:</b> 09/04-17/2019 <b>GPS:</b> 18.365953, -66.153767	
<b>Inspector:</b> Gregory Sondergeld / Alexander Nieves	<b>Damage Facility:</b> Main Bldg.	

<b>Damage Description:</b>	<b>Item #:</b> 13	<b>Damage Description:</b>	<b>Item #:</b> 14
Wall, ¼ IN thick plaster on concrete, repair spalling, discolored, caused by rain water intrusion (Main Bldg., Exterior, Entire Floor)		Wall, ¼ IN thick plaster on concrete, painted, peeling paint, caused by rainwater intrusion (Main Bldg., Exterior, Entire Floor)	
<b>Additional Comments:</b>		<b>Additional Comments:</b>	



<b>Damage Description:</b>	<b>Item #:</b> 15	<b>Damage Description:</b>	<b>Item #:</b> 16
Floor, sealed concrete, epoxy-coated, peeling paint, caused by surface water flooding (Main Bldg., Exterior, Handicap-Access Ramp)		Hand Rail, Hand rail, galvanized steel piping, 2 IN-dia., double rail, painted finish, peeling paint, caused by wind-driven rain (Main Bldg., Exterior, Ramp)	
<b>Additional Comments:</b>		<b>Additional Comments:</b>	



<b>Applicant:</b> Universidad Central Del Caribe, Inc.	<b>Damage Inventory:</b> 305240	<b>Category:</b> E
<b>WO #</b> 46525 <b>FIPS#</b> 021-UNUGB-00	<b>Date:</b> 09/04-17/2019	<b>GPS:</b> 18.365953, -66.153767
<b>Inspector:</b> Gregory Sondergeld / Alexander Nieves	<b>Damage Facility:</b> Main Bldg.	

<b>Damage Description:</b>	<b>Item #:</b> 17
Wall, ¼ IN thick plaster on concrete, repair spalling, cracked, caused by rainwater intrusion (Main Bldg., Exterior, Entire Floor)	
<b>Additional Comments:</b>	

<b>Damage Description:</b>	<b>Item #:</b> 18
Wall, ¼ IN thick plaster on concrete, painted, discolored, caused by rainwater intrusion (Main Bldg., Exterior, Entire Floor)	
<b>Additional Comments:</b>	



<b>Damage Description:</b>	<b>Item #:</b> 19
Entrance Canopy, metal-framed, arch-shaped, painted with fabric covering, broken components, caused by high winds (Main Bldg., Exterior, Wooden Patio Deck)	
<b>Additional Comments:</b>	

<b>Damage Description:</b>	<b>Item #:</b> 20
Wooden Deck Railing, 3 FT tall, with 2 IN x 4 IN top rail and angled balustrades spaced at 6 IN on-center, painted, broken components, caused by high winds (Main Bldg., Exterior, Wooden Patio Deck)	
<b>Additional Comments:</b>	



<b>Applicant:</b> Universidad Central Del Caribe, Inc.	<b>Damage Inventory:</b> 305240	<b>Category:</b> E
<b>WO #</b> 46525 <b>FIPS#</b> 021-UNUGB-00	<b>Date:</b> 09/04-17/2019	<b>GPS:</b> 18.365953, -66.153767
<b>Inspector:</b> Gregory Sondergeld / Alexander Nieves	<b>Damage Facility:</b> Main Bldg.	

<b>Damage Description:</b>	<b>Item #:</b> 27
Wall, ¼ IN thick plaster on concrete, painted, peeling paint caused, by wind-driven rain (Main Bldg., Exterior, Generator Shed Area)	
<b>Additional Comments:</b>	

<b>Damage Description:</b>	<b>Item #:</b> 26
Roof, Ribbed metal roofing, 26-gauge, galvanized, broken components. caused by high winds (Main Bldg., Exterior, Generator Shed Area)	
<b>Additional Comments:</b>	



<b>Damage Description:</b>	<b>Item #:</b> ENTER #
<b>Additional Comments:</b>	

<b>Damage Description:</b>	<b>Item #:</b> ENTER #
<b>Additional Comments:</b>	

